

Smart Array 5i and 532 version 2.56

This Smart Array firmware will recommend updates for some SCSI disk drive models after the Smart Array firmware has been installed. To avoid notification during the POST routine, update any applicable hard disk drives before updating the Smart Array firmware.

Disk drive firmware components are available from:

http://h18000.www1.hp.com/support/files/storage/us/locOsCat/99_56.html

If a component is not available for the affected disk drive model, download the following ROMPaq:

<http://h18000.www1.hp.com/support/files/server/us/download/17149.html>

A later version of the disk drive firmware may be available and should be used.

| Disk Drive Model | Minimum Firmware | Disk Drive Family |
|------------------|------------------|--------------------|
| AB009335B8 | A019 | SCSI 9GB 7200 WU |
| AB018335B9 | A019 | SCSI 18GB 7200 WU |
| AD00435332 | A415 | SCSI 4GB 10K WU |
| AD009335C9 | A018 | SCSI 9GB 10K WU |
| AD00935335 | A915 | SCSI 9GB 10K WU |
| AD018335CA | A018 | SCSI 18GB 10K WU |
| AD018345A6 | A011 | SCSI 18GB 10K WU |
| BB009135B4 | B021 | SCSI 9GB 7200 WU2 |
| BB009235B6 | B021 | SCSI 9GB 7200 WU2 |
| BB018135B5 | B021 | SCSI 18GB 7200 WU2 |
| BB018235B7 | B021 | SCSI 18GB 7200 WU2 |
| BD004153C3 | B415 | SCSI 4GB 10K WU2 |
| BD004253C4 | B415 | SCSI 4GB 10K WU2 |
| BD00962A66 | B008 | SCSI 9GB 10K WU3 |
| BD0096349A | 3B12 | SCSI 9GB 10K WU3 |
| BD009635C3 | B022 | SCSI 9GB 10K WU3 |
| BD00965333 | B915 | SCSI 9GB 10K WU3 |
| BD00972A69 | B008 | SCSI 9GB 10K WU3 |
| BD009735C6 | B022 | SCSI 9GB 10K WU3 |
| BD00975334 | B915 | SCSI 9GB 10K WU3 |
| BD01862A67 | B008 | SCSI 18GB 10K WU3 |
| BD0186349B | 3B12 | SCSI 18GB 10K WU3 |
| BD018635C4 | B022 | SCSI 18GB 10K WU3 |
| BD0186459A | B011 | SCSI 18GB 10K WU3 |
| BD01872A6A | B008 | SCSI 18GB 10K WU3 |
| BD018735C7 | B022 | SCSI 18GB 10K WU3 |
| BD018745A3 | B011 | SCSI 18GB 10K WU3 |
| BD036635C5 | B022 | SCSI 36GB 10K WU3 |
| BD0366459B | B011 | SCSI 36GB 10K WU3 |
| BD036735C8 | B022 | SCSI 36GB 10K WU3 |
| BD036745A4 | B011 | SCSI 36GB 10K WU3 |
| BD0726459C | B011 | SCSI 72GB 10K WU3 |
| BF01865222 | B009 | SCSI 18GB 15K WU3 |
| BF03665223 | B009 | SCSI 36GB 15K WU3 |
| DGHS09U | 01C0 | SCSI 9GB 7200 WU |
| DGHS09Y | 01C0 | SCSI 9GB 7200 WU |
| DGHS18Y | 01C0 | SCSI 18GB 7200 WU |
| ST19171 | 9A10 | SCSI 9GB 7200 WU |